- 1	FHEA	FHEA	MANE OLY A			ASS'Y P/N: 51140E391 SHEET: 1
ł	AEF.	AEV.	DRAWING MEF. DESIGNATION	FARLURE MODE AND CAUSE	FAILURE EFFECT ON END LIEM	HOWR / FUNC. RATIONALE FOR ACCEPTANCE
	1370	HING	THC DEHODIM ATOR GIY-3 SCHENATIC ED 87325	HODE: UNCOMMANDED, OUTPUT IN ONE OR HORE AXES. CAUSE(S): (1) LOSS OF +12 OR -12 SUPPLY. (2) IMMALANCE OUE TO PARTS FATLURE.	UNCOMMANDED MOTION IN ONE OR MORE AXES UHEN OPERATING IN MANUAL MODE. IF NOT IN MANUAL MODE CANNOT ENTER INTO A MANUAL MODE. LIMEXPECTED MOTION, 6 JOINT RUMANAT, LIMANNUNCTATED. CREW ACTION REG, REDUNDANT PATHS REMAINING N/A	DESIGN FEATURES THE DEMODULATOR, FOR EACH OF THE THE AMES, COMPRISES OF A TRAMSFORMER-DRIVEN DIODE/RESISTOR BRIDGE WHOSE OUTPUT IS COMDITIONED BY TWO OPERATIONAL AMPLIFIER STACES. HREE DEMITCAL CIRCUITS ARE PACKAGED ON A PRINTED CIRCUIT BOARD WHITE ALL STATES OF THE ASSEMBLY. THE MODULE IS NEURANICALLY JOINED TO A DUMPY BOARD, ACONG TWO EDGES BY MACHINED SPACERS. A CENTRAL SPACER PROVIDES ADDITIONAL STIFFFRING OF THE ASSEMBLY. THE MODULE IS SUPPORTED IN MACHINED CUIDEWAYS IN THE ELECTRONICS PACKAGE. LATERAL RESTRAINT IS PROVIDED BY TWO PARS OF BOAR SPRINGS ENGAGING THE QUIDEWAYS. THE LOWER EDGE OF EACH BOARD INTERFACES VIA A PRINTED CIRCUIT BOARD COMMECTOR AND THE MODULE IS RESTRAINED BY THE ELECTRONICS PACKAGE COVER WHICH BEARS ON A PAIR OF COMPRESSIBLE WEDGES ON THE UPPER EDGE OF THE MODULE. THE */- 12 VDC SUPPLY IS ROUTED THROUGH THE PCB CONNECTOR. THE COMMECTORS WERE SUBJECTED TO CONSTRUCTION AMALYSIS TO ENSURE PERFORMANCE. EEE PARTS HAVE BEEN SELECTED AND CONTROLLED IN ACCORDANCE WITH SPAR. PA. DOS. THIS DOCUMENT DEFINES THE PROGRAM REQUIREMENTS FOR MONITORING AND CONTROLLING EEE PARTS. THE REQUIREMENTS FOR MONITORING AND MONITORING AND PARTS HEREDIA PARTS. SELECTION TO AT LEAST "ESTABLISHED RELIFIED TO ENSURE AND ADEQUATE DEFRING THE PARTS. THE FOREIGN AND PARTS HEREDIA PARTS. SELECTION TO AN LEAST "ESTABLISHED RELIFIED TO PARTS SELECTION TO AN LEAST "ESTABLISHED RELIFIED TO ENSURE AND ADEQUATE DEFRICATION OF A PARTS HEREDIA PARTS. SELECTION TO AN EXPERT SETTING THE PARTS. WHITCH FAILURE FALLS HEREDIA PARTS. SELECTION TO AN SERVED THE PARTS. WHITCH FAILURE AND ADEQUATE DEFRICATION OF REPERAL HIM PARTS. HIS DEFENDENCE DEFRICATION AND FOREST THE PARTS. WHITCH FAILURE AND ADEQUATE DATE AND ADEQUATE FOR THE MASS ADDOT OF REPRESENTED TO ENSURE AND ADDOT OF THE MASS ADDOT OF
	,	211 84	21	UPERCEDING DATE:	U6 DCT B7	DALL: 07 DEC 00

Page 1 of 4:

CRITICAL ITEMS LIST

THEA REF.	FMEA REV.	NAME, QTY, & DRAWING REF.	FAILURE MODE	FAILURE EFFECT	1	SYSTEM: DAC ASS'Y P/N:	: SHEET: _
		DESIGNATION	AND CAUSE	ON END ITEM	HOWR / FUNC. 3/1 CRITICALITY	RATIONALE FOR AC	
1370	1	THC DEMODULATOR OFY-3 SCHEMATIC ED 87325	HODE: UNCOMPANDED OUTPUT IN U ONE OR MORE AMES,	UNCOMMANDED MOTION IN ONE OR MORE AKES WHEN OPERATING IN MANUAL MODE.	BOARD ASSEMBLY	SCREENS: DRAWINGS INCLUDE THE COORDANCE WITH NHB 530	 OLDERING 9800A.
			CAUSE(S); (1) LOSS OF +12 OR -12 SUPPLY.	IF NOT IN MANUAL MODE CANNOT ENTER INTO A MANUAL MODE.			
			(2) IMBALANCE DUE TO PARTS FAILURE.	WORST CASE UNEXPECTED MOTION. 6 JOINT RUNAUMY. UNANMARCIATED. CREW ACTION REQ.			
				REDUNDANT PATHS REMAINING N/A			
				ŀ			
							!
		;					
				·			İ

CRITICAL ITEMS LIST

AS	S'Y NOMENCLATURE: DI	C PANEL	SYSTEM: DEC SUBSYSTEM ASS'Y P/H: 51140E3P1 S	
i	FAILURE EFFECT	HOUR / FUNC.	RATIONALE FOR ACCEPTANCE	-

MRET. MANNE DEALINE ROLE PAILURE EFFECT MOUR / HUNC. RATIONALE FOR ACCEPTANCE MOUR / HUNC. RATIONALE
THE DEMODERATION OF THE PROPERTY OF THE PROPER
PRE-TEST INSPECTION, INCLUDES CHECKING FOR DANAGED COMPONENTS, THE TEST AREA ENVIRONMENT, VISUAL INSPECTION OF THE TEST AREA ENVIRONMENT, VISUAL INSPECTION OF THE TEST ARE THAT ARE IN CONTACT WITH THE UNIT, CALIBRATION/VALIDATION OF TEST EQUIPMENT FIC.

FNEA REF.	FMEA REV.	NAME OTY & ORAWING REF. DESIGNATION	FAILURE MODE AND CAUSE	FAILURE EFFECT ON END ITEM	HOUR / FUNC. RATIONALE FOR ACCEPTANCE 1/1 CRITICALITY SCREENS: N/A
1370		THC DEHODULATOR GFY-3 SCHEMATIC ED 07325	MODE: UNCOMMANDED OUTPUT IN DIME OR MORE AXES. CAUSE(\$): (1) LOSS OF +12 OR -12 SUPPLY. (2) IMBALANCE OUE TO PARTS FAILURE.	UNCOMMANDED MOTION IN ONE OR MORE AKES WHEN OPERATING IN MANUAL MODE. IF HOT IN MANUAL MODE CANNOT ENTER INTO A MANUAL MODE. WORST CASE UNEMPECTED MOTION. 6 JOINT RUMANALY. UNANHUNCIATED. CREW ACTION REQ. REQUIDDANT PATHS REMAINING M/A	MODULE TESTING, INCLUDES CALIBRATION AND AMBIENT FUNCTIONAL LESSING. (CAE/GOVERNMENT REP MANDATORY INSPECTION POINT). PRE-LEST INSPECTION OF THE ASSY. INCLUDES AN AUDIT OF LOWER TIER INSPECTION COMPLETION, AS BUILT CONFIGURATION VERIFICATION TO AS DESIGN ETC. (\$PAR/GOVERNMENT REP MANDATORY INSPECTION POINT). A TEST READINESS REVIEW (TRR) WHICH INCLUDES VERIFICATION OF TEST PERSONNEL TEST DOCUMENTS, TEST EQUIPMENT CALIBRATION/VALIDATION STATUS AND MARDATE OF DEGENATION IS CONVENED BY QUALITY ASSURANCE IN CONJUNCTION WITH ENGINEERING RELIBBILITY COMPLICATION CONTROL SUPPLIER AS APPLICABLE AND THE COVENIEMT REPRESENTATIVE, PRIOR TO THE START OF ANY FORMAL ESTING (ACCEPTANCE OR CUALIFICATION). ACCEPTANCE SESTING (ACCEPTANCE OR CUALIFICATION). ACCEPTANCE SESTING (ACCEPTANCE OR CUALIFICATION). ACCEPTANCE SESTING (ASSURED AND MANDATORY INSPECTION POINT). LIMEGRATION OF DEC PANEL, BNC, TNC AND MCIU, INSPECTIONS ARE PERFORMED AT EACH STACE OF INTEGRATION, WHICH INCLUDES GOUNDING CHECKS, INTER CONNECT CASTE VERTIFICATION, COMMECTOR INSPECTION OF BEST OR PUSHBACK CONTACTS ETC. SUB-SYSTEM PERFORMANCE TESTING (ATP), INCLUDES AN AMBIENT PERFORMANCE TEST. (MANDATORY INSPECTION OF MECHANICAL ARM SUBASSEMBLIES AND THE FLIGHT CABIN EQUIPMENT TO FORM THE SURS. INSPECTIONS ARE PERFORMED AT EACH PHASE OF INTEGRATION UNION, INSTECTIONS ARE PERFORMED AT EACH PHASE OF INTEGRATION UNION, INTERPECTION FOR BEST OF DEST OR PUSH BACK CONTACTS ETC. SMMS SYSTEMS INSEGNATIONS FOR BEST OR PUSH BACK CONTACTS ETC. SRMS SYSTEMS IESTING - STRONGBACK AND FLAT FLOOR AMBIENT PERFORMANCE TEST. (SPAR/GOVERNMENT REP MANDATORY INSPECTION POINT)
REPARED BY	': <u>M</u> I	NG	SUPERCEDING DATE	: <u>06 OCT B/</u>	DATE: 07 DEC 90 CIL REV: 2

FHEA REF.	FHEA REV.	NAME, QTY, & DRAWING REF.	FAILURE HODE	FAILURE EFFECT	HOUR / FUNC. RATIONALE FOR ACCEPTANCE	
ME1.		DESIGNATION	CAUSE	END TIEM	CRITICALITY SCREENS: N/A	
1370	1	THE DEMODULATOR GIY-3 SCHEMATIC EO 87325	HODE: UNCOMMANDED OUTPUT IN ONE OR MORE AXES. CAUSE(\$): (1) LOSS OF *12 OR *12 SUPPLY. (2) INMALANCE OUE TO PARTS FAILURE.	UNCOMMANDED MOTION IN OME DR MORE AXES WHEN OPERATING IN MANUAL MODE. IF NOT IN MANUAL MODE CANNOT ENTER INTO A MANUAL MODE. UNEXPECTED MOTION. 6 JOINT RUMANALY. UMANUALY. UMANUALY. UMANUALY. UMANUALY. REDUNDANT PATHS REMAINING	FAILURE MISTORY REFER FAR 4013, ONE DEMODULATOR OUTPUT WAS INTERMITTENTLY CHRCUIT. DURING QUALIFICATION TESTING AND SUBSEQUENT FLIGHT HARDMA TESTING, A MUMBER OF OPEN-CIRCUIT AND INTERMITTENT CIRCUIT FAILURES WERE EXPERIENCED. THESE FAILURES WERE ATTRIBUTABLE TO A POOR QUALITY FEATUR ASSOCIATED WITH THE PRINTED CIRCUIT BOARD CONNECTORS, FORMITHE DEC ELECTRONICS PACKAGE. THE FEMALE CONNECTORS, FORMITHE AIRBORN COMPANY AND WERE PROCURED TO MISTORY CONTACTS OF THESE CONNECTORS EXHIBITED INTERMITTENT CONTABLEMENT THE SOCKET CONTACT LEAVES AND THE SOLDER TAIL. CONNECTOR FROM ALTERNATE SUPPLIERS WERE EVALUATED FOR CONSTRUCTION FEATURES OF SOCKET CONTACTS AND THE TEXAS INSTRUMENT PRODUCT WAS SELECTED. ALL ELECTRONICS PACKAGE FILM WIRING ASSEMBLIES HAVE BEEN BESORKED TO FIT THE IMPROVED CONNECTOR. NO SUBSEQUENT FAIL HAVE BEEN EXPERIENCED.	RE E IM NG KET
				H/A	FAR 4308: DEC S/N 202 NOV 89 DESCRIPTION	
					Y-AKIS DEMODULATOR FOR THE COMMANDS IS NOW FUNCTIONAL. CORRECTIVE ACTION	
					FAULTY DIODE ATCR3 REPLACED. ALL DIODES OF SAME LOT DATE REPLACED.	

DATE: 07 DEC 90

_____ CIL REV: _2

SUPERCEDING DATE: 06 OCT 87

THEA REV. DAMAINS RES. DESCRIPTION CAUSE AND THEM END TIEM CRITICALITY SCREENS: W/A 1370 1 THE OPROCULATOR GIVES AND THE WORLD COUNTY IN CRITICALITY SCREENS: W/A 1370 1 THE OPROCULATOR GIVES AND THE WORLD COUNTY IN CRITICALITY SCREENS: W/A 1370 1 THE OPROCULATOR GIVES AND THE WORLD COUNTY IN CRITICALITY SCREENS: W/A 1370 1 THE OPROCULATOR GIVES AND THE WORLD COUNTY IN CRITICALITY SCREENS: W/A 1370 1 THE OPROCULATOR GIVES AND THE WORLD COUNTY IN CRITICALITY SCREENS: W/A 1370 1 THE OPROCULATOR GIVES AND THE WORLD CONTROL EFFECTS OPERATIONAL EFFECTS OPERATIONAL EFFECTS ARM DOES NOT RESPOND PROPERLY TO COMMANDS OR DRIVES MITHOUT COMMAND. WHEN THE COMMAND OF REMOVED, THE ARM CONTINUES TO THE COMMAND OF THE ARM CONTINUES TO THE COMMAND OF THE COMMAND OF THE ARM CONTINUES TO THE COMMAND OF THE ARM CONTINUES TO THE COMMAND OF THE ARM CONTINUES TO THE COMMAND OF THE COMMAND OF THE ARM IS RESOURCED FROM THE PROPERTY TO COMMANDS. IF 11 ISN'T, APPLY BRAKES. THE CREW WILL BE TRAINED TO ALWAYS OBSERVE WHETHER THE ARM IS RESOURCED FROM THE PROPERTY TO COMMANDS. IF 11 ISN'T, APPLY BRAKES. THE CREW WILL BE TRAINED TO ALWAYS OBSERVE WHETHER THE ARM IS RESOURCED FROM THE PROPERTY TO COMMANDS. IF 11 ISN'T, APPLY BRAKES. THE CREW WILL BE TRAINED TO ALWAYS OBSERVE WHETHER THE ARM IS RESOURCED FROM THE PROPERTY TO COMMANDS. IF 11 ISN'T, APPLY BRAKES. WISSION COMMITTEE UNIVERSITY OF THE WILL WOLFACE AT DAC PAREL CULTPUT GRAND OF THE WOLFT OF THE WOLFT. WAS AND THE THE COMMAND OF THE WOLFT OF	1TICA	L ITEMS LIST		PROJECT: SAMS ASS'Y MOMENCEATURE: <u>DEC PANEL</u>			SYSTEM: DEC SUBSYSTEM ASS'Y P/N: 51140E391 SHEET	
DEMODURATION OFF. 3 SCHEMATIC ED 87325 CAUSE(\$): (1) LOSS OF +12 OR -12 SUPPLY. CAUSE(\$): (2) JIMALANCE DUE TO PARTS FAILURE. CAUSE TERMINIO A RAUGUL MODE. MODES NOT RESPOND PROPERLY TO COMMANDS ON DRIVES MITHOUT DRIVE. CREW ACTION APPLY BRAKES. THE CREW WILL BE TRAINED TO ALMAYS ORSERVE WHETHER THE ARM IS RESPONDING PROPERLY TO COMMANDS. IF 11 ISN'T, APPLY BRAKES. MISSION CONSTRAINT REPAINING MISSION CONSTRAINT OPÉRATE UNDER VERNIER RAISE WITHIN 10 F1 OF STRUCTURE. THE OPÉRATOR RESPONDING PROPERLY TO COMMANDS VIA WINDOW AND/OR CCTV VIEWS DURING ALL ANN OPERATIONS. OMESD OFFLIME APPLY EQUIVALENT MULL VOLTAGE TO N, Y, Z IMPUIS. VERTEY N, Y, Z QUIPUT VOLTAGE AT DAC PÂNEL OUIPUIT OMESD ONLINE TURNARCUMD			DRAWING REF.	AND	ON	1/1		
OMRSD ONLINE INSTALLATION NOME OMRSD ONLINE TURNAROUND			THC DEMODULATOR OTY-3 SCHENATIC	MODE: UNCOMMANDED OUTPUT IN ONE ON MORE AXES. CAUSE(\$): (1) LOSS OF +12 ON -12 SUPPLY. (2) IMBALANCE DUE TO PARTS	INCOMMANDED HOTION IN ONE OR MORE AXES WHEN OPERATING IN MAMMAL MODE. IF NOT IN MANUAL MODE CAMNOT ENTER INTO A MANUAL MODE. MORST CASE UNEMPECTED MOTION, & JOINT RUNALAY, UNANUMICIATED. CREM ACTION REQ. REMAINING	CRITICALITY OPERATIONAL E ARM DOES NOT COMMAND, WHEN DRIVE. CREW ACTION APPLY BRAKES. CREW TRAINING THE CREW WILL RESPONDING PR MISSION CONST OPERATE UNDER OPERATOR MIST PROPERLY TO C ARM OPERATION OMESD OFFLINE	RESPOND PROPERLY TO COMMANDS OR DRIVES WE THE COMMAND IS REMOVED, THE ARM CONTINUE BE TRAINED TO ALMAYS OBSERVE WHETHER THE OPERLY TO COMMANDS. IF IT ISN'T, APPLY BE ABLE TO DETECT THAT THE ARM IS RESPONDED ON MANDS VIA WINDOW AND/OR CCTV VIEWS DURING.	ARM IS RAKES.
VERIFY BIT COUNT IN EACH AXES.						OMESO ONLINE OMESO ONLINE OMESO ONLINE	TURNAROUND THE NULL POSTION	

CIL REV: 2

DATE: 07 DEC 90

RMS/D&C - 302

SUPERCEDING DATE: 06 OCT 87